

无基材双面胶带

TRANSFER TAPE

性能特点 Features


- ▶ 无基材胶带是纯胶膜产品不受基材形变的限制，对基材的密着性能良好；
- ▶ 高粘着力，对难粘表面（如 PP 塑料、泡棉）都有良好的粘结强度；
- ▶ 耐侯、耐高温、耐水性能良好，可生产两面覆纸产品，易于冲切加工。
- ▶ AMK9471、9472 专门针对低表面能材料粘接使用
- ▶ Transfer tape is pure adhesive product that not limited by the deformation of the substrate, and has good adhesion;
- ▶ Good adhesion to low surface energy like PP or foam;
- ▶ Good weather resistance, temperature resistance and water resistance.could produce double sided release liner like sandwich,is easy for die cutting.
- ▶ AMK9471/9472 has very good stick performance for low surface energy.

推荐应用 Application recommend

- ▶ 电器行业塑料材料、泡棉材料的粘贴与固定；
- ▶ 薄膜开关和柔性线路板行业的低表面能塑料的粘贴等；
- ▶ 手机、电脑、电器、通讯等导电屏蔽材料的粘贴固定。
- ▶ Pasting and fixing of plastic materials and foam materials in the electrical industry;
- ▶ Pasting of low surface energy plastics in the membrane switch and flexible circuit board industries, etc;
- ▶ The adhesion and fixation of conductive shielding materials for mobile phones, computers, electrical appliances, communication equipment, etc.



产品结构 Product Structure

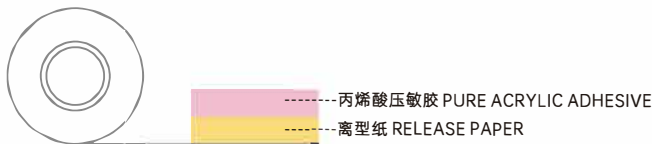

型号 Item	胶系 Adhesive	厚度 Thicknss (mm)	颜色 Color	180°剥离力 180°Peeling force (N/in)	保持力 Holding power (Hour)	耐温性 Tem.resistance(°C)	规格 Size
408M	Acrylic	0.08	透明Transparent	14	> 48	-20 ~ 120	1240mm*100m
410M	Acrylic	0.1	透明Transparent	15	> 48	-20 ~ 120	1240mm*100m
405M	Acrylic	0.05	透明Transparent	13	> 48	-20 ~ 120	1240mm*100m
405A	Acrylic	0.05	透明Transparent	13	> 48	-20 ~ 120	1240mm*100m
413M	Acrylic	0.13	透明Transparent	15	> 48	-20 ~ 120	1240mm*100m
413A	Acrylic	0.13	透明Transparent	15	> 48	-20 ~ 120	1240mm*100m
9471	Acrylic	0.05	透明Transparent	15	> 48	-20 ~ 120	1240mm*100m
9472	Acrylic	0.13	透明Transparent	18	> 48	-20 ~ 120	1240mm*100m

注：本资料所有数据均在奥米科标准条件下测试所得。所有数据并非保证值，仅供参考。1、胶带厚度中不包括剥离层的厚度。2、可以根据客户的要求个案生产。
3、要达到最佳的粘接效果，粘接表面必须是洁净、干燥的，胶带应用的最佳温度范围是21-38℃，建议若初始粘接温度低于10℃时，不适宜粘接，因此时的胶粘剂可能会变硬，而无法牢固粘接在物体上；但是，如果已经粘接上了，低温下的持粘力同样是令人满意的。

Note: The data sheet is obtained under the AMK lab standard test for reference. 1. The thickness excludes the released liner thickness. 2. Manufacturing can be customized. 3. Before laminating, all foreign materials such as dirt, water and oil should be cleaned and dried. Or you may get unexpected results different from this data sheet. To obtain optimum adhesion, the bonding surfaces must be clean, dry and well unified. Some typical surface cleaning solvents are isopropyl alcohol or heptane. * Ideal tape application temperature range is 21°C to 38°C. Initial tape application to surfaces at temperatures below 10°C is not recommended because the adhesive becomes too firm to adhere readily. However, once properly applied, low temperature holding is generally satisfactory.